





Compact Line Calibration Rig

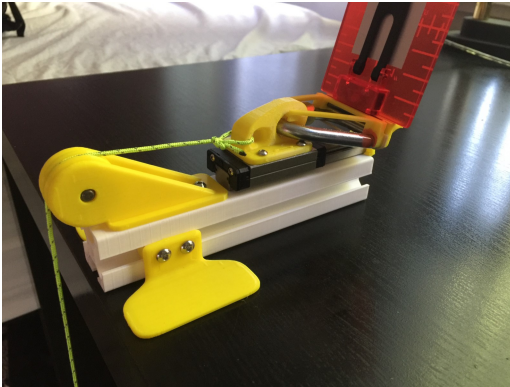


1. Clamp Line Rig at Edge of Flat Surface. Attach required weights to leader line.

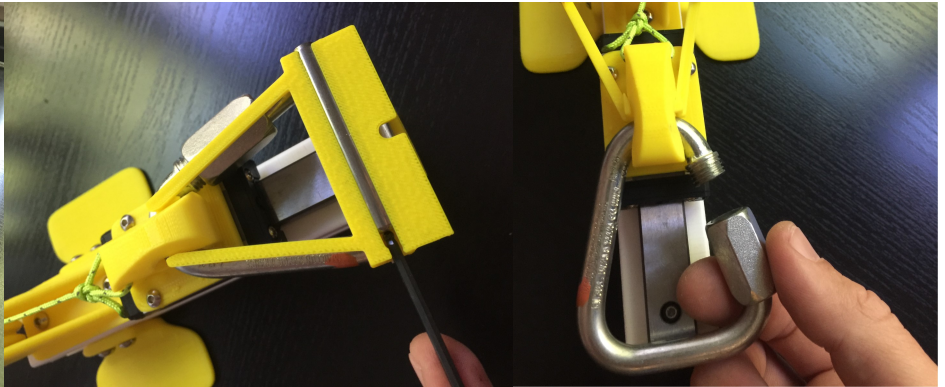



2. Push out Steel Rod with Allen Wrench or Screwdriver.



3. Carefully, Flip Up Target Mount Open Maillon for Riser.

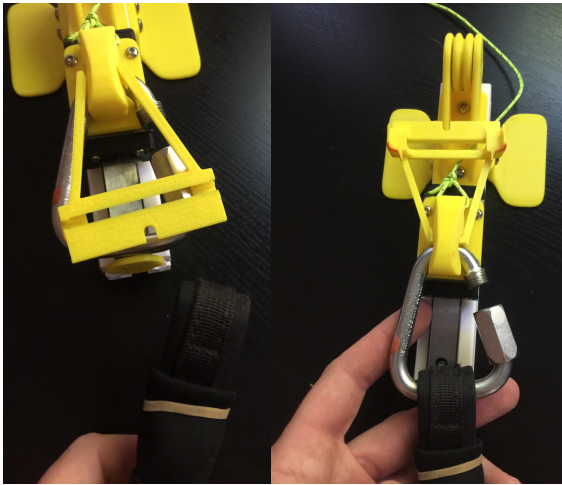

4. Place Rubber Band Around Riser and Attach to Maillon, Close.

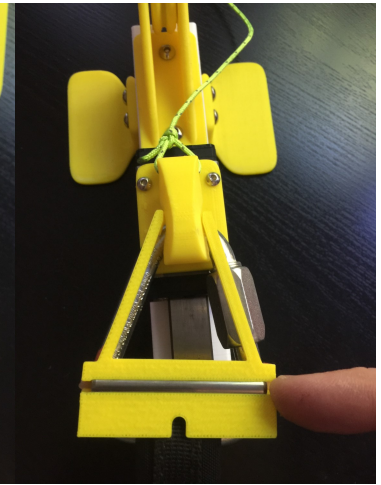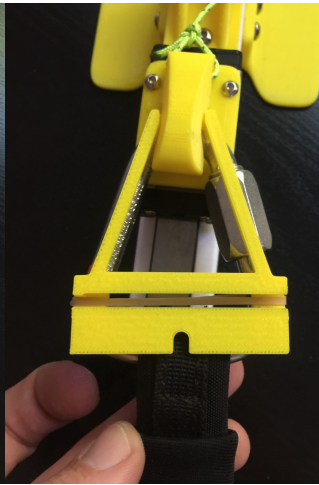


5. Secure Laser Target Mount with Rubber Band. Replace Steel Rod for Laser Target Mounting.



6. Attach Laser Target Using Magnet.



7. When Measuring Do Not Bottom Out to ensure proper Loading

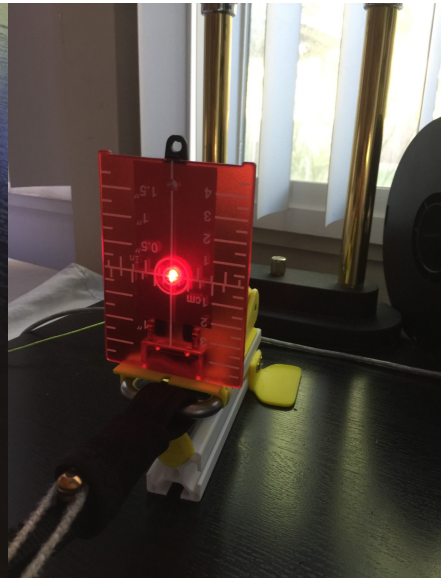

8. Measure Lines, get that glider in trim. Be Safe. Have Fun.